
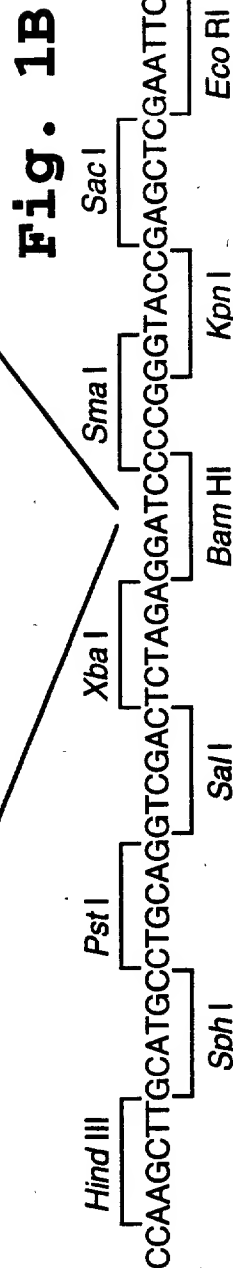


11/10/2017 10:02:33

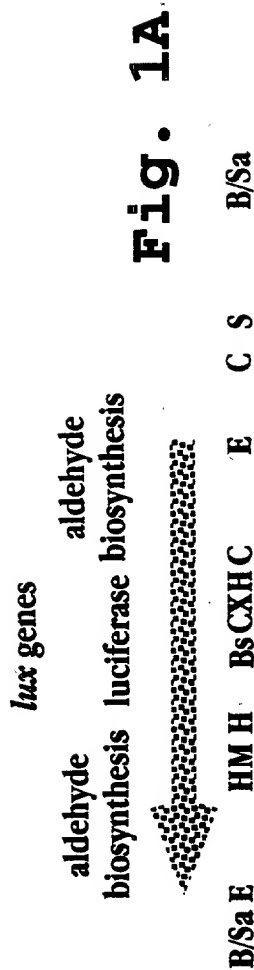

MCS

To Fig. 1C

From Fig. 1B

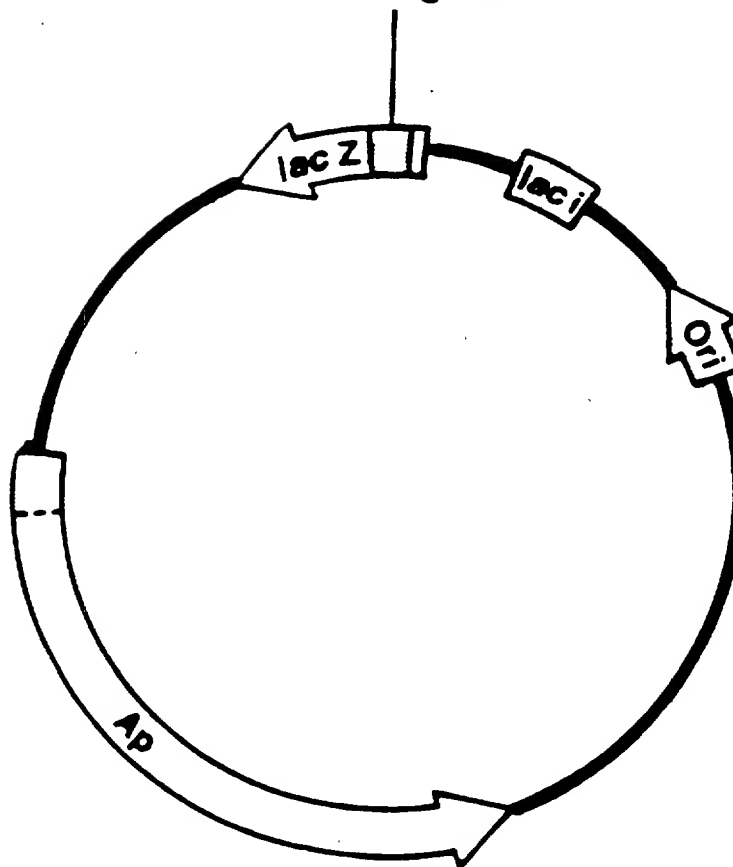


Fig. 1C

447020-1E902E80

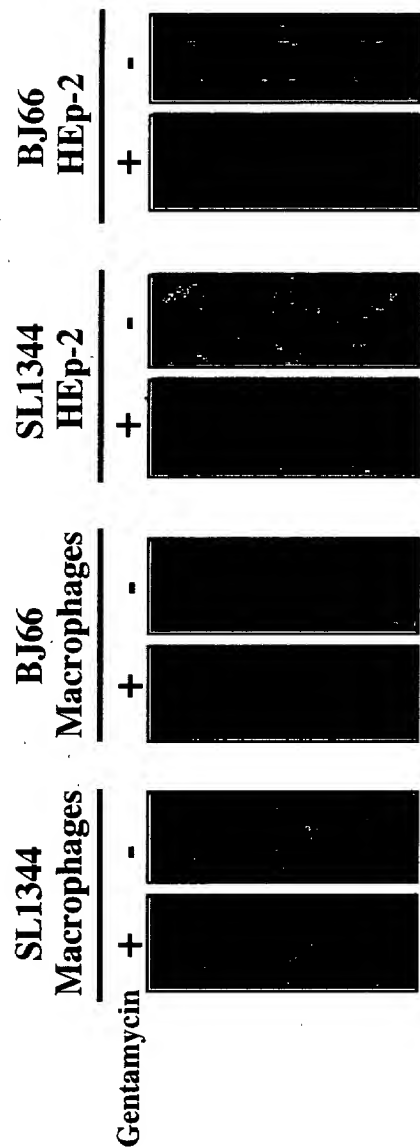


Fig. 2A

145T0227E002280

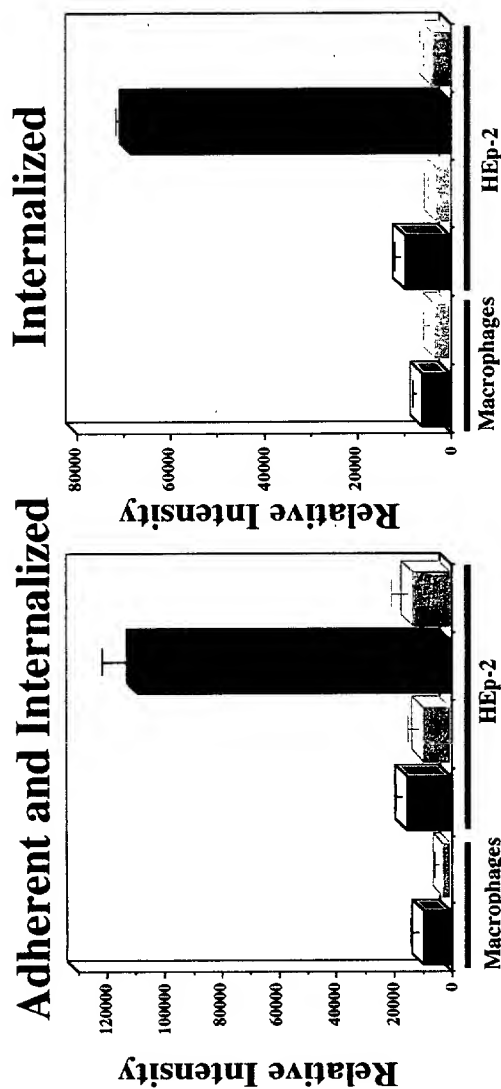


Fig. 2D

Fig. 2B

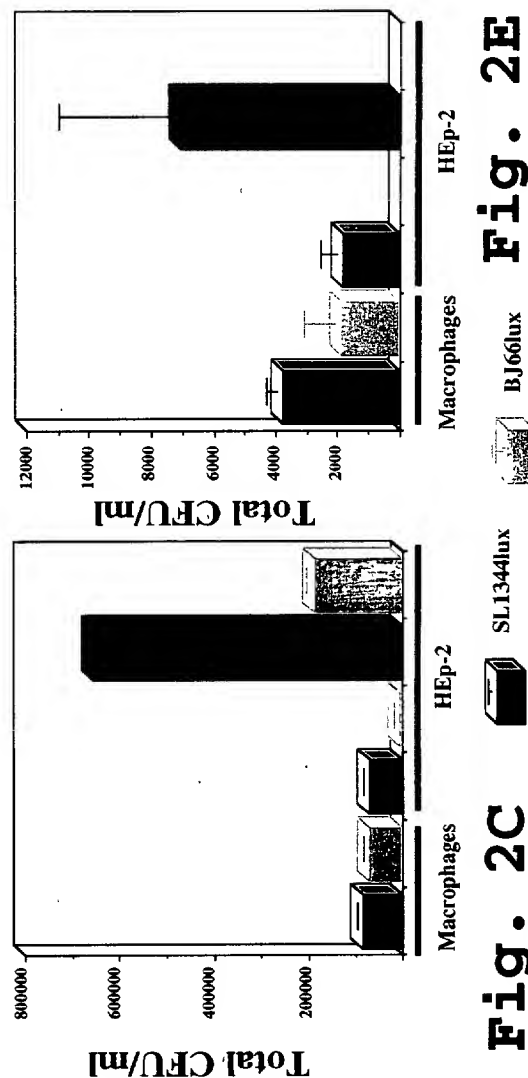


Fig. 2E

Fig. 2C

 


Fig. 6

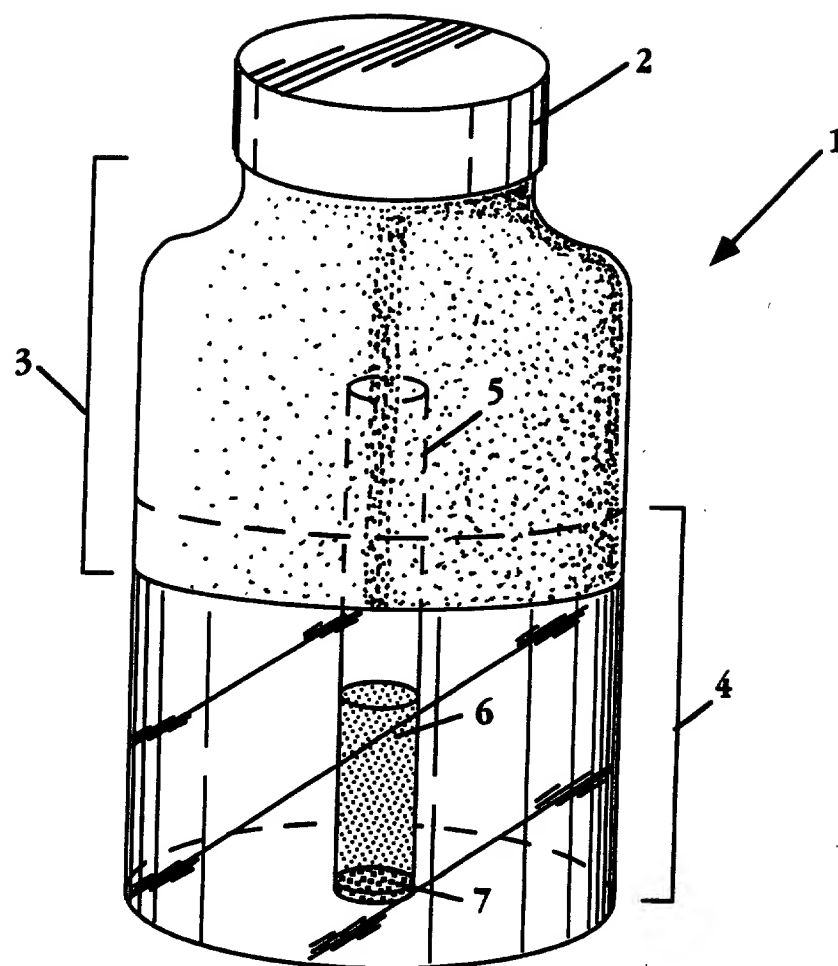


Fig. 4

167740-7E904230

Fig. 5A

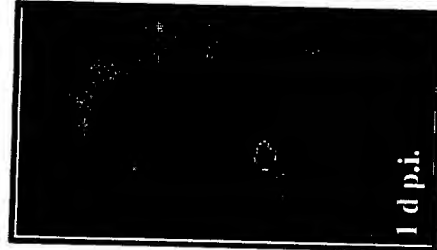


Fig. 5B

LB5000lux

Fig. 5C Fig. 5D Fig. 5E Fig. 5F



BJ66lux



SL1344lux

Fig. 7A



Fig. 7B



08/270631

16F0297E902380

Fig. 8A

External



Fig. 8B

Internal



Fig. 8C

Air Injected



BJ66lux Infection (7 d p.i.)

Fig. 9A

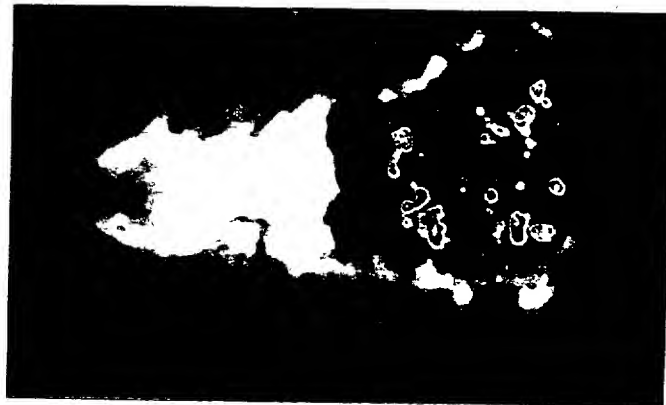


Fig. 9B

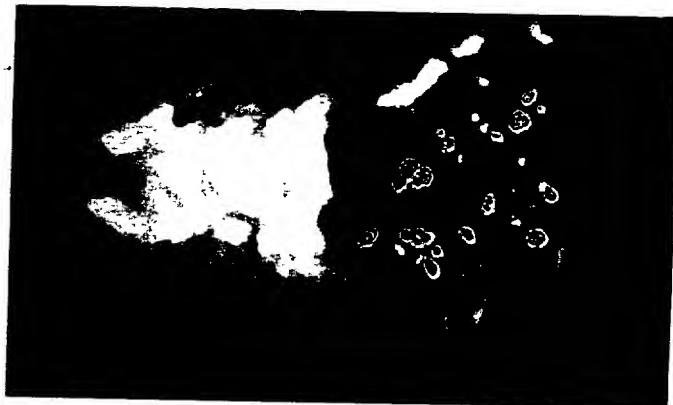


Fig. 90

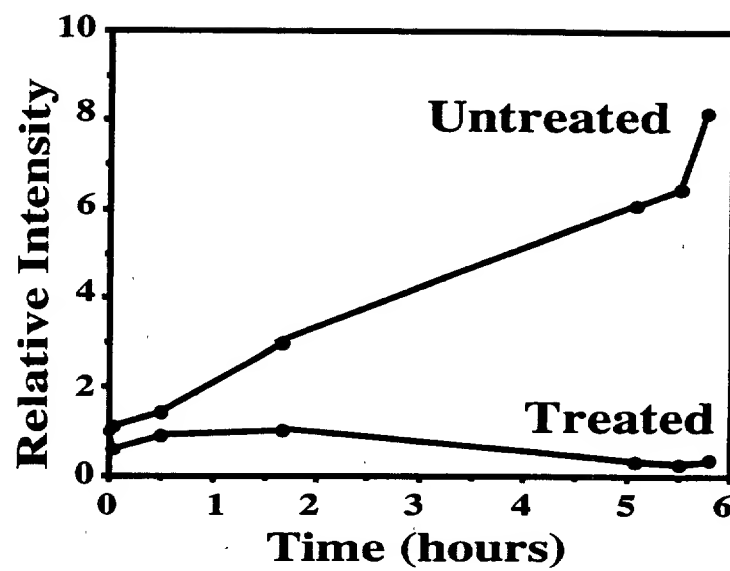


Fig. 10A

461020-12902280

5.5 h

Untreated

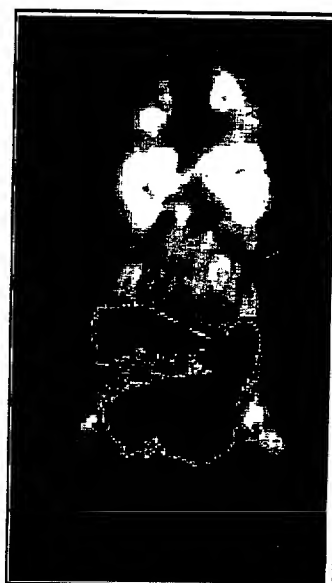


Fig. 10B Fig. 10C

Treated



Fig. 10D Fig. 10E